


NEW Mechanics Type Universal Joint
Fits Vehicle Type: A
(except early T-207 models)
Part #09:980526 **\$65**



NOS Large Detroit Type Universal Joint - Intermediate Shaft Only
[Ord # 7337334] Fits Vehicle Type: B (except early models),C,D,E,F,G,H Part #09:947553 **\$35**

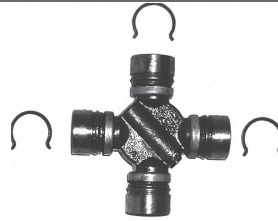

NOS Mechanics Universal Joint Clamp
Fits Vehicle Type: A (except early T-207 models) Part #09:913468 **\$5**



NEW Small Detroit Type Universal Joint
[Ord # 7372622]
Fits Vehicle Type: A
(early T-207 models only),B,C,D,E,F
Part #09:947556 **\$24**



NOS Universal Joint Clamp Bolt
A-early T-207 models only Fits Vehicle Type:
A,B,C,D Part # 09:575724 **\$2**



NOS Detroit Universal Joint Clamp
Fits Vehicle Type: A (early T-207 models only) B,C,D Part #09:575723 **\$5**




Quick Tip 12: Proper Drive Shaft Installation

I am hearing a clinking noise coming from the drive shaft area -- what could this be?

One of the most commonly made mistakes in reinstalling drive shafts is having them out of phase. If you are having trouble with "clinking" U-joints, or U-joints wearing out quickly, be sure you check your shafts for this problem. The figure below shows a typical cross section of a prop shaft with universal joints. Note the alignment arrows on the splined yoke and the tubular prop shaft. When the arrows are not aligned, the splined yoke can be slipped over the prop shaft in any position so that the U-joints are not in alignment (or the same position), this creates a problem where the joints are working against each other.

The splined yoke can only be correct in 2 positions, (180 degrees) from each other. When reinstalling your prop shaft make sure that your pinion flange and transfer case flange (in the case of front and rear drive shafts) are in the same position. If the position is 90 degrees difference between the two, the end result will be U-joints "clunking". Because of a build up of grease on your shafts, you may not be able to see the alignment arrows. If you remove the splined yoke from the shaft, make sure that when it is re-assembled, the U-joint ends of the splined yoke and prop shaft are in the same position. Aren't you just dying to get out tonight and check your shafts?

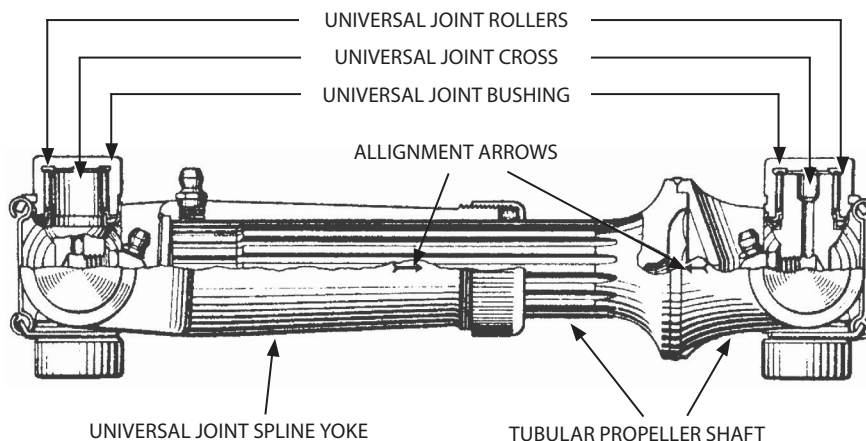

Cross Section of Propeller Shaft and Universal Joints

GROUP 9: PROPELLER SHAFT



NEW U-Joint Small Clamp

1957-71 models with 3000# front axle
Fits Vehicle Type: G
Part # 09:1795049 **\$5**



NEW Companion Flange Bolt

Fits Vehicle Type: E,F
Part #09:123841 **\$3**



sleeve



sleeve
applicator

Drive Shaft Assemblies



- Complete with slip yoke & U-joints VC & early WC 1/2 ton Detroit type with tapered tube front or rear WC 1/2 ton mid-series Detroit type with straight tube, front or rear Part #CC91450 **\$200**
- WC 1/2 ton late Mechanics type, front or rear Part #CC921200 **\$200**
- WC 3/4 ton 98" wheel base (WC 51, 52, 56, 57) rear shaft with slip yoke Part #CC924654 **\$125**
- NOS M37/M43 Front Drive Shaft Assy Part #09:7351101 **\$325**
- NOS M37 Rear Drive Shaft Assy Part #09:7373708 **\$275**
- NOS M37-M43 Intermediate Drive Shaft Assy Part #09:7373706 **\$225**



NOS Oil Seal Yoke Felt - Detroit

E,F-Trim one spline to fit.
Fits Vehicle Type: A (except T- 207)
B,C,D,E,F Part #09:563099 **\$4**



NOS Slip Yoke Oil Seal Cap

[Ord # 7349100] Fits Vehicle Type: A
(early T-207 models only) B,C,D,E,F
Part #09:572515 **\$5**



NOS Oil Seal Yoke Washer - Detroit

A-(early T-207 intermediate shaft only)
Fits Vehicle Type: A,B,C,D
Part #09:572485 **\$2**



NOS Oil Seal Yoke Washer - Mechanics

- Front or Rear Drive Shaft Only
Fits Vehicle Type: A (except T-207)
Part #09:917071 **\$2**
- Intermediate Drive Shaft Only
Fits Vehicle Type: A (except T-207)
Part #09:917081 **\$2**

NOS Pinion Yoke (not shown)

Fits Vehicle Type: B,C,D
Part #09:599087 **\$65**



NOS Pinion Seal Deflector

Prevents dirt & debris from
destroying your pinion seal
Fits Vehicle Type: A,B,C,D,E,F
Part #09:1030807 **\$5**



NEW Pinion Flange Yoke Washer

(Use with Part
#09:855094)
Fits Vehicle Type:
A,B,C,D
Part #09:308466 **\$3**




**NOS Pinion
Flange Yoke Nut**

- Plain Type
D-WM-300 models
requires using
1556556 washer
Fits Vehicle Type: D
Part #09:1662942 **\$5**
- Castle Type
C,D,E,F replaces
926228 with addition
of lock washer
Fits Vehicle Type:
A,B,C,D,E,F
Part #09:855094 **\$5**

Propeller Shafts

Typical Exploded Parts View
Most parts in stock for all models

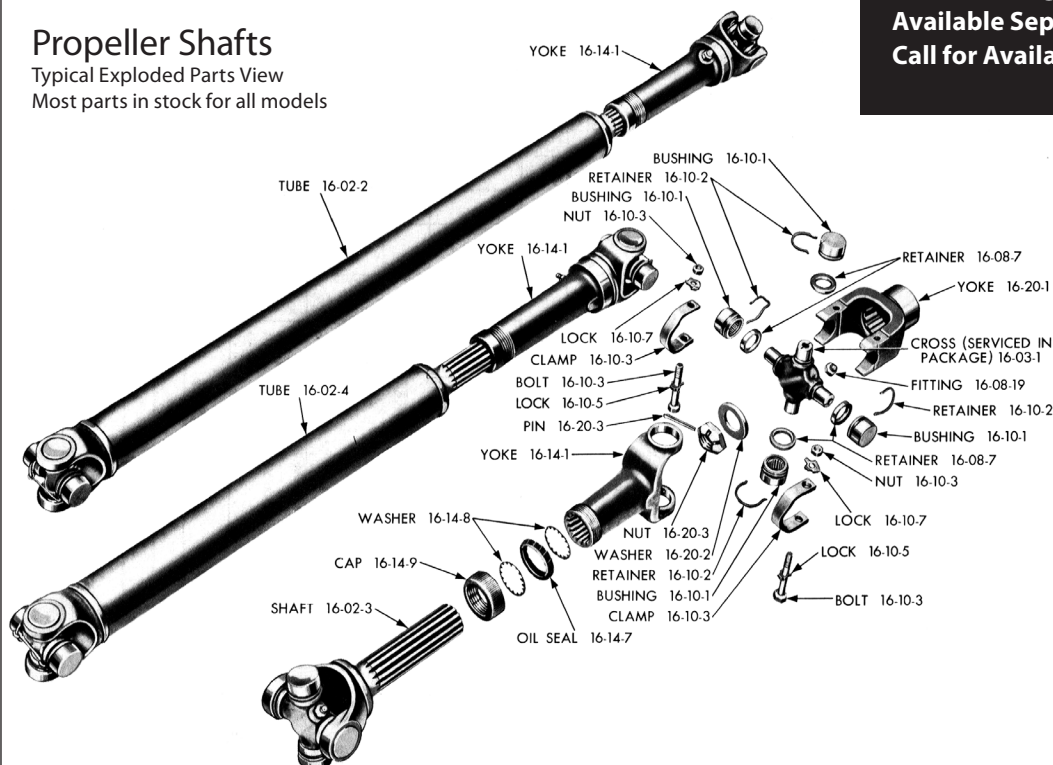

**Individual Shafts,
Yokes & Flanges
Available Separately
Call for Availability**